

OH Line Hazard Patrol & Follow Up Sheet - CREW REPORT

Year 2016	MV Hazard Patrol		
Patrol Order Number	900734772		
MV Block No. (FL)	501866096-MV		
MV Block Description	CCN 01 S	Date	21/03/2016
Patroller	Sean Cronin	Reports	Crew, Timber
Sheet Number	1 / 3	Version	1.04

Urgency Description	
Repair immediately	A
Repair within 3 months	B
Repair within 6 months	C
Repair within 12 months	D

Broken Cross Arm											
Item Number	Hazard Number	Urgency Code	X	Y	Pole Number	Nearest Sub / Switching Point	Comment	Photos	X-Arm Type	Disc or Pin	Insulator Quantity
1	1	C	89427	93815	12	020864	one strut on xarm		9 1PH IMP/LAP	Pin	2
3	1	B	88953	92139	1	A4956	Strut down on x arm 3 ph imp		1 3PH IMP/LAP	Pin	3

Badly Shattered Insulator										
Item Number	Hazard Number	Urgency Code	X	Y	Nearest Pole No.	Nearest Sub / Switching Point	Comment	Photos	Disc or Pin	Number to be Replaced
4	4	B	88146	91858	35	A4977	3 ph break p35		Disc	1
10	4	A	87832	91382	6	020149	Broken pin insulator single ph break lap		Pin	1

Others									
Item Number	Hazard Number	Urgency Code	X	Y	Pole Number	Nearest Sub / Switching Point	Comment	Photos	Action
5	12	A	87909	91769	40	201	NA	HC5564-199-1	Short Cable Guard

SAP Task List Group : FOMVHAZ

Hazard No. Description: 1-Broken Xarm -2Broken Bind, 3 Broken Stay Wire, 4 Badly Shattered Insulator, 5 Building Conflict, 6 Dangerous Timber - External Contractor, 7 Very Badly Leaning Pole, 8 Obvious Bad Ground Clearance, 9 Unrecorded Network, 10 Damaged Conductor strand(s), 11 LV Run Through, 12 Others, 13 Hazards Cleared through IWM Order (OCR), 14 Replace Pole, 15 Galvanised Steel Conductor - Replace, 16 Severely Corroded Conductor

OH Line Hazard Patrol & Follow Up Sheet - CREW REPORT

Year 2016	MV Hazard Patrol		
Patrol Order Number	900734772		
MV Block No. (FL)	501866096-MV		
MV Block Description	CCN 01 S	Date	21/03/2016
Patroller	Sean Cronin	Reports	Crew, Timber
Sheet Number	2 / 3	Version	1.04

Urgency Description	
Repair immediately	A
Repair within 3 months	B
Repair within 6 months	C
Repair within 12 months	D

Others									
Item Number	Hazard Number	Urgency Code	X	Y	Pole Number	Nearest Sub / Switching Point	Comment	Photos	Action
6	12	A	87815	91738	41	201	p40 and p41 both sets of cables broken from T bars extra cable guards needed for both poles	HC5564-202-1	Short Cable Guard
7	12	B	87854	92103	2	169	mv earth and lv earth both overground horses in field	HC5564-207-1	Tank Earth
8	12	B	87700	91739	43	572x	add cable guard		Short Cable Guard
9	12	B	87613	91544	1	A4955	NA		Short Cable Guard
11	12	B	88575	91033	19	020989S	NA		Short Cable Guard

Replace Pole						Nearest Sub / Switching Point Number				Replace-ment Pole Code	X-Arm Type	Disc of Pin Insulators	Insulator Quantity
Item Num	Hazard Num	Urgency Code	X	Y	Pole Num		Comment	Photos	Scantrepo Pole				

SAP Task List Group : FOMVHAZ

Hazard No. Description: 1-Broken Xarm -2Broken Bind, 3 Broken Stay Wire, 4 Badly Shattered Insulator, 5 Building Conflict, 6 Dangerous Timber - External Contractor, 7 Very Badly Leaning Pole, 8 Obvious Bad Ground Clearance, 9 Unrecorded Network, 10 Damaged Conductor strand(s), 11 LV Run Through, 12 Others, 13 Hazards Cleared through IWM Order (OCR), 14 Replace Pole, 15 Galvanised Steel Conductor - Replace, 16 Severely Corroded Conductor

OH Line Hazard Patrol & Follow Up Sheet - CREW REPORT

Year 2016	MV Hazard Patrol		
Patrol Order Number	900734772		
MV Block No. (FL)	501866096-MV		
MV Block Description	CCN 01 S	Date	21/03/2016
Patroller	Sean Cronin	Reports	Crew, Timber
Sheet Number	3 / 3	Version	1.04

Urgency Description	
Repair immediately	A
Repair within 3 months	B
Repair within 6 months	C
Repair within 12 months	D

Replace Pole													
Item Num	Hazard Num	Urgency Code	X	Y	Pole Num	Nearest Sub / Switching Point Number	Comment	Photos	Scantrepo Pole	Replace-ment Pole Code	X-Arm Type	Disc of Pin Insulators	Insulator Quantity
12	14	A	88707	91151	16	020989S	Insulator broken hole in pole due to tracking unsafe to climb	HC5564-230-1	No	315	1 3PH IMP/L AP	Pin	3

SAP Task List Group : FOMVHAZ

Hazard No. Description: 1-Broken Xarm -2Broken Bind, 3 Broken Stay Wire, 4 Badly Shattered Insulator, 5 Building Conflict, 6 Dangerous Timber - External Contractor, 7 Very Badly Leaning Pole, 8 Obvious Bad Ground Clearance, 9 Unrecorded Network, 10 Damaged Conductor strand(s), 11 LV Run Through, 12 Others, 13 Hazards Cleared through IWM Order (OCR), 14 Replace Pole, 15 Galvanised Steel Conductor - Replace, 16 Severely Corroded Conductor

OH Line Hazard Patrol & Follow Up Sheet – TIMBER REPORT

Year 2016	MV Hazard Patrol		
Patrol Order Number	900734772		
MV Block No. (FL)	501866096-MV		
MV Block Description	CCN 01 S	Date	21/03/2016
Patroller	Sean Cronin	Reports	Crew, Timber
Sheet Number	1 / 1	Version	1.04

Urgency Description	
Repair immediately	A
Repair within 3 months	B
Repair within 6 months	C
Repair within 12 months	D

Dangerous Timber						Nearest Sub / Switching Point Number			Meters to cut	Plantation	Owner	Owner Name and Address
Item Number	Hazard Number	Urgency Code	X	Y	Pole Num		Comment	Photos				
2	6	B	91097	92126	1	A5042		HC5564-174-1	10	No	NA	NA

SAP Task List Group : FOMVHAZ

Hazard No. Description: 1-Broken Xarm -2Broken Bind, 3 Broken Stay Wire, 4 Badly Shattered Insulator, 5 Building Conflict, 6 Dangerous Timber - External Contractor, 7 Very Badly Leaning Pole, 8 Obvious Bad Ground Clearance, 9 Unrecorded Network, 10 Damaged Conductor strand(s), 11 LV Run Through, 12 Others, 13 Hazards Cleared through IWM Order (OCR), 14 Replace Pole, 15 Galvanised Steel Conductor - Replace, 16 Severely Corroded Conductor